



MODEL 6.2R

Reptile UVB Lamp Meter • 0-1999 $\mu\text{W}/\text{cm}^2$

*Handheld Digital UVB Radiometer
with Integral Sensor*



APPLICATIONS

- Model 6.2R Reptile UVB Lamp Meter is ideally suited to determine if UVB lamps are performing to manufacturer's specifications, gauge intensity, and measure aging over time



ENVIRONMENT



REPTILES / PETS



OUTDOOR
ACTIVITIES

FEATURES AND BENEFITS

- Compact, Handheld, and Durable
- Simple Single-Button Operation
- NIST Traceable Accuracy
- LCD Display
- Made In USA

SENSOR

Silicon Carbide (SiC) photodiode packaged in a hermetically sealed UV glass window cap. Interference filter blocks most UVA from response as shown on Spectral Sensitivity Graph.

METER OPERATION

To operate your Solarmeter, aim the sensor window located on the top panel of the meter directly at a UV source. Press and hold the push-button switch on the face of the meter. For best results take note of the distance the reading was taken from the UV source in order to ensure repeatable results.

Battery operation voltage is viable from 9V down to 6.5V. Below 6.5V, the numbers on the LCD display will begin to dim, indicating the need for battery replacement. Under typical service load, a standard 9V battery will last approximately 2 years.

PROPER USAGE OF SOLARMETER™ ULTRAVIOLET RADIOMETER

- Wear eye protection when checking UV lamps (Glasses that provide wrap around protection are ideal).
- Allow lamps to warm up prior to taking readings (at least 15 minutes).

LAMP AGING

- When checking lamp aging, make sure to use the same location and distance to ensure accurate readings.
- Lamps should be replaced when output drops to about 50% of their original (new) readings.

100 East Glenside Avenue
Glenside, PA 19038 USA

SolarMeter.com

1.215.517.8700



ISO 9001
2015



MODEL 6.2R

Reptile UVB Lamp Meter • 0-1999 $\mu\text{W}/\text{cm}^2$

GENERAL

- Do not subject the meter to extremes in temperature, humidity, shock or dust. If accidentally exposed to extreme humidity or damp conditions, abnormally high readings may occur. Allowing the meter to dry out naturally or placing it in a bag with silica gel will restore normal function
- Use a very soft cloth to clean the instrument. Keep sensor free of oil, dirt, etc.

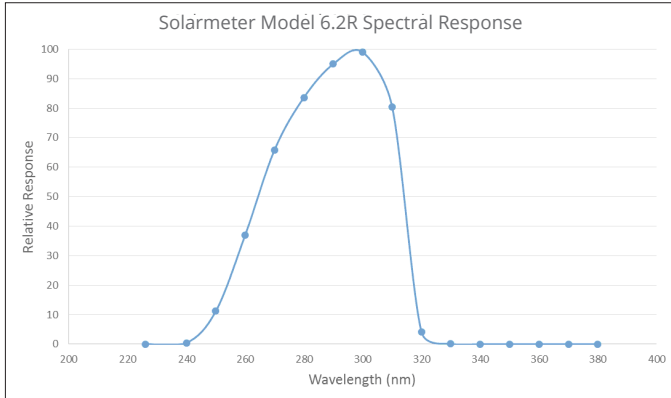


Fig. 1. Model 6.2R Spectral Response

SPECIFICATIONS

| | |
|-------------------------|---|
| MODEL | 6.2R |
| IRRADIATION RANGE | 0-1999 $\mu\text{W}/\text{cm}^2$ UVB |
| RESPONSE | 280-322 nm UVB |
| RESOLUTION | 1 $\mu\text{W}/\text{cm}^2$ |
| CONVERSION RATE | 3.0 Readings / Sec |
| DISPLAY | 3.5 Digit LCD |
| DIGIT SIZE | 0.4" / 10.2 mm |
| OPERATIONAL TEMPERATURE | 32°F to 100°F / 0°C to 37.8°C |
| OPERATIONAL HUMIDITY | 5% to 80% RH |
| ACCURACY | $\pm 10\%$ Ref. NIST |
| METER DIMENSIONS | 4.2L x 2.4W x 0.9D in / 106.7L x 61W x 22.9D mm |
| WEIGHT | 4.5 oz / 128g Including Battery |
| POWER SOURCE | 9-Volt DC Battery |
| LENS | UV Glass |
| DIFFUSER | Teflon |
| AGENCY APPROVAL | CE Mark |

REV A | MODEL 6.2R | Apr 2020
Specifications subject to change without notice.

SOLARMETER™ by Solar Light Company Inc. is the industry standard for UV and visible light radiometers that measure both indoor and outdoor light sources. Our NIST Traceable meters are used to monitor lamp irradiance and aging for UV sterilization, reptile husbandry, indoor tanning, red/blue light phototherapy, UV curing and UV Index.